

Date: Monday, 11/05/2009 1:22:37 PM
 User: Julie Dawson

Process Sheet

Customer	: CU-DAR001 Dart Helicopters Services	Drawing Name	: ARM
Job Number	: 47865 -1		
Estimate Number	: 12883		
P.O. Number	:	Part Number	: D3560043
This Issue	: 11/05/2009 S.O. No. :	Drawing Number	: D3560 REV D
Prsht Rev.	: NC	Project Number	: N/A
First Issue	: // Type : MACHINED PARTS	Drawing Revision	: D
Previous Run	: 46619	Material	:
Written By	:	Due Date	: 28/05/2009
Checked & Approved By	: <u>JULIE DAWSON 09.05.11</u>	Qty:	<u>split 1</u> Um: Each
Comment	: Est Rev:A New Issue 07.05.24 EC		
	: Est Rev B ECN 987 07.10.09 EC		
	: Est Rev:C ECN1048 07-12-18 DD verified by: EC		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0	M6061T6B0500X05000	6061-T6 Bar .500 x 5.00
-----	--------------------	-------------------------



Comment: Qty.: 1.3598 f(s)/Unit Total : 5.4390 f(s)
 6061-T6 Bar 0.50" x 5.00"
 Batch: M111408

mk 09/05/20

(4)

2.0	BAND SAW	BAND SAW
-----	----------	----------



Comment: BAND SAW
 Cut blanks 15.500" long

mk 09/05/20

(4)

3.0	HAAS1	HAAS CNC VERTICAL MACHINING #1
-----	-------	--------------------------------



Comment: HAAS CNC VERTICAL MACHINING #1

1- Mill as per Folio FA695 Rev: D & Dwg D3560 Rev: D

2-C'sink 0.196" hole on manual mill as per dwg D3560

3-Deburr per dwg D3560

B.A

09/05/23

(4)

4.0	QC2	INSPECT PARTS AS THEY COME OFF MACHINE
-----	-----	--



Comment: INSPECT PARTS AS THEY COME OFF MACHINE

B.A

09/05/23

(4)

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 11/05/2009 1:22:37 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: ARM

Job Number: 47865

Part Number: D3560043

Job Number:



Seq. #:

Machine Or Operation:

Description :

5.0

QC8

SECOND CHECK



Comment: SECOND CHECK

mk 08/05/28

(4)

6.0

D35921

Plate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 4.0000 Each(s)

PLATE *B47015*

09.06.05

7.0

LARGE FAB 1

LARGE FABRICATION RESOURCE 1



Comment: LARGE FABRICATION RESOURCE 1

1-Weld assembly as per dwg D3560

STEP:

- 1- clean material (buff bracket and bottom of arm with blue pad) *th*
- 2- set up bracket and arm on jig *th*
- 3- preheat bracket and arm with torch *th*
- 4- clean before welding with brush *th*
- 5- set up machine to 135 amps *th*
- 6- weld across bottom and top ends *th*
- 7- reheat with torch (65 deg C) *th*
- 8- on one side weld from bottom to top half way *th*
- 9- same for other side (half way) *th*
- 10- from half way point weld the rest of the first side (ease off pedal near end) *th*
- 11- same for remaining side (ease off pedal near end) *th*

09.06.05

8.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

09.06.08

9.0

QC9

VISUAL WELDING INSPECTION



Comment: VISUAL WELDING INSPECTION

09.06.09

10.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

09.06.10

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Monday, 11/05/2009 1:22:37 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: ARM

Job Number: 47865

Part Number: D3560043

Job Number:



Seq. #:

Machine Or Operation:

Description :

11.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

09-06-10 (X)

12.0

D2808

Bushing



Comment: Qty.: 1.0000 Each(s)/Unit Total : 4.0000 Each(s)

Spacer

batch:

B41708

09/06/10

13.0

SMALL FAB 1

SMALL & MEDIUM FAB RESOURCE 1



Comment: SMALL & MEDIUM FAB RESOURCE 1

1-Press bushing in D3560 arm per dwg D3562

09/06/10 (X)

14.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

09/06/10 (X)

15.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and Stock

Location:

WPA

09-06-10

16.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

09/06/11

Job Completion



mf
09-06-10

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____


NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries


RELEASED
07.12.16

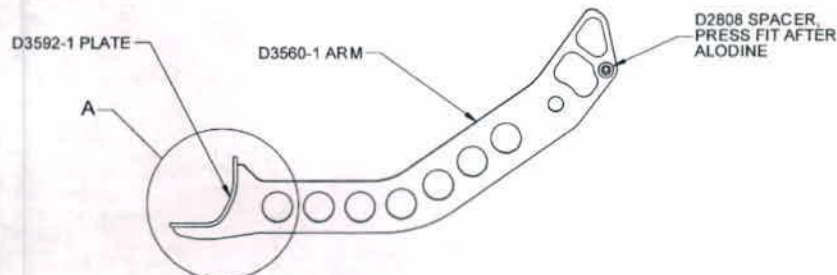

D3560-041 ARM WELDMENT

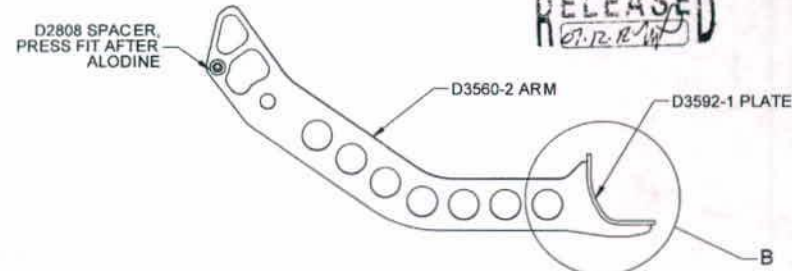


D3560-042 ARM WELDMENT

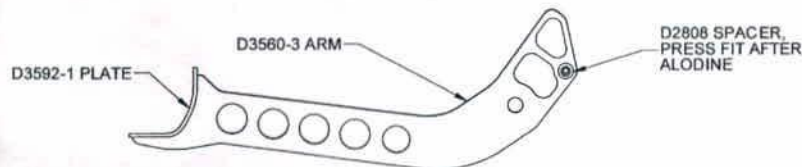


D3560-043 ARM WELDMENT



D3560-044 ARM WELDMENT

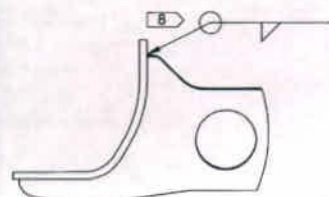

**DETAIL A
SCALE 1 : 2**

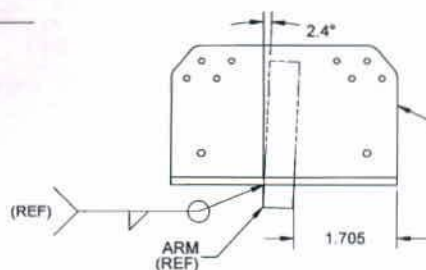

**DETAIL B
SCALE 1 : 2**

PARTS LIST

QTY -041	QTY -042	QTY -043	QTY -044	P/N	DESCRIPTION
X				D3560-041	ARM WELDMENT
	X			D3560-042	ARM WELDMENT
		X		D3560-043	ARM WELDMENT
			X	D3560-044	ARM WELDMENT
1	1	1	1	D2808	SPACER
1				D3560-1	ARM
	1			D3560-2	ARM
		1		D3560-3	ARM
			1	D3560-4	ARM
1	1	1	1	D3592-1	PLATE

DESIGN	ADD D2808 PRESS FIT NOTE; REDRAWN IN SOLIDWORKS	DC	07.11.16
DRAWN	REMOVE POWDER COAT	CP	07.06.19
CHECKED	REDESIGN AS WELDMENT, ADD POCKETS	CP	07.01.15
MFG. APPR.	NEW ISSUE	CP	06.09.25
APPROVED		BY	DATE
DE APPR.			
DATE	07.11.16		


DART AEROSPACE LTD
HAWKESBURY, ONTARIO, CANADA

DRAWING NO. **D3560**
TITLE **ARM WELDMENT**
SCALE **1:4**

COPYRIGHT © 2006 BY DART AEROSPACE LTD
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

NO. 47806
WORK ORDER
SUBJECT TO AMENDMENT
UNCONTROLLED
ENGINEERING
RETURN TO
SHOP COPY
SCALE 1:2




- NOTES:
- 1) MATERIAL: N/A
 - 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
 - 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
 - 4) UNITS: INCHES UNLESS OTHERWISE NOTED
 - 5) BREAK SHARP EDGES: 0.005 TO 0.015 MAX
 - 6) IDENTIFICATION: N/A
 - 7) WEIGHT: 1.23 lbs (TYP)
 - 8) WELDING: PER DART QSI 004

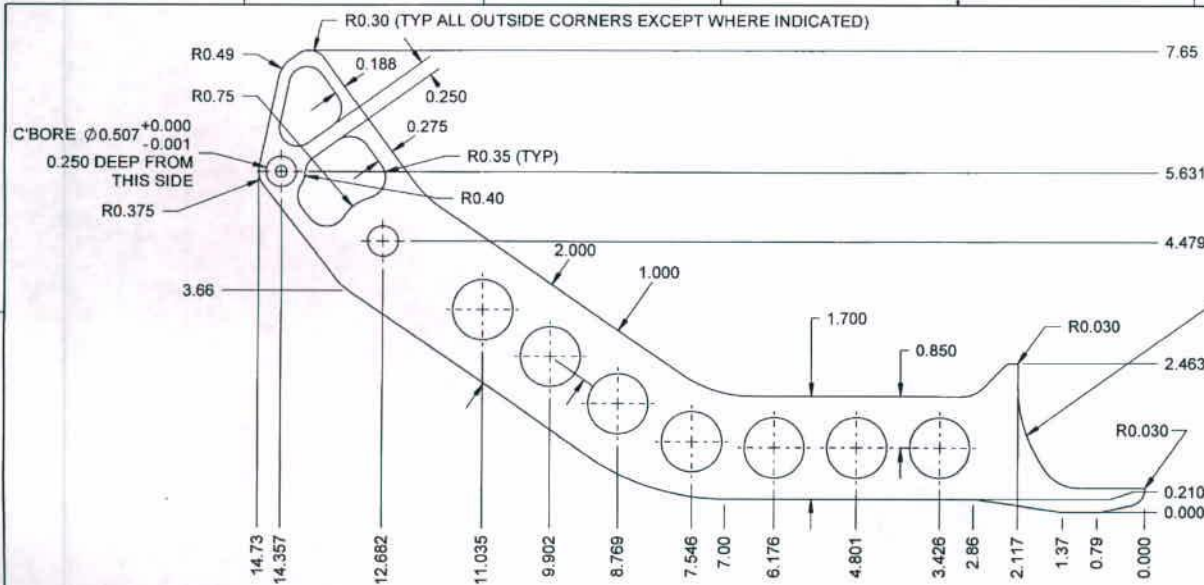

PROFILE TO MATCH
D3592-1 PLATE,
MACHINE AT 2.4°,
SEE VIEW D-D

D3560-2 ARM


- NOTES:
- 1) MATERIAL: 6061-T6 (OR 6061-T651/T6510/T6511/T62) BAR, 0.500 THICK
PER AMS-QQ-A-225/8 (OR AMS 4117/4128/4115/4116) OR
PER AMS-QQ-A-200/8 (OR AMS 4160)
(REF. DART SPEC. M6061T6B0.500)
 - 2) FINISH: NONE
 - 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
 - 4) UNITS: INCHES UNLESS OTHERWISE NOTED
 - 5) BREAK SHARP EDGES: 0.005 TO 0.015 MAX
 - 6) IDENTIFICATION: N/A
 - 7) WEIGHT: 1.05 lbs

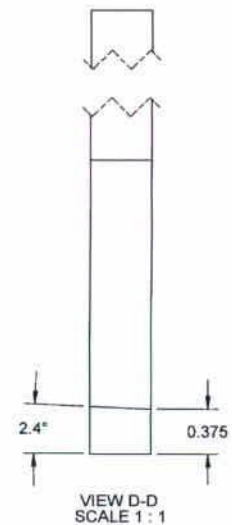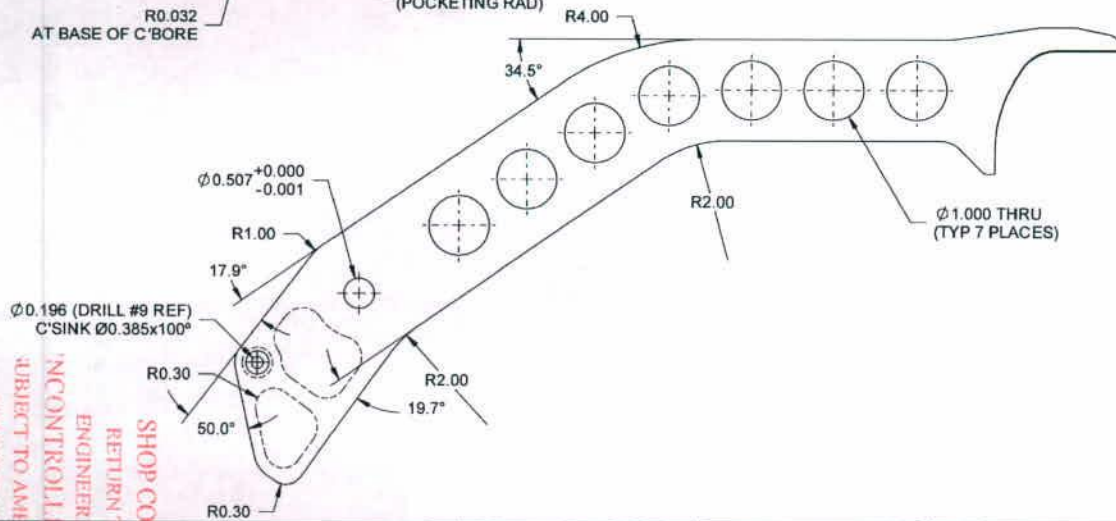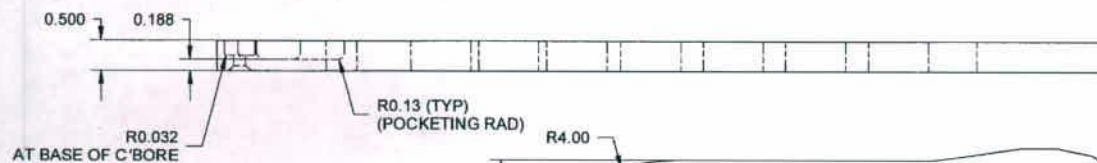

DESIGN	<i>JP</i>	DART AEROSPACE LTD	
DRAWN	<i>JC</i>	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>JP</i>	DRAWING NO.	REV. D
MFG. APPR.	<i>JP</i>	D3560	SHEET 3 OF 5
APPROVED	<i>JP</i>	TITLE	SCALE
DE APPR.	<i>JP</i>	ARM WELDMENT	1:2
DATE	07.11.16	COPYRIGHT © 2008 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD			

NO. 47805
WORK ORDER
SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE

PROFILE TO MATCH
D3592-1 PLATE
MACHINE AT 2.4°
SEE VIEW E-E


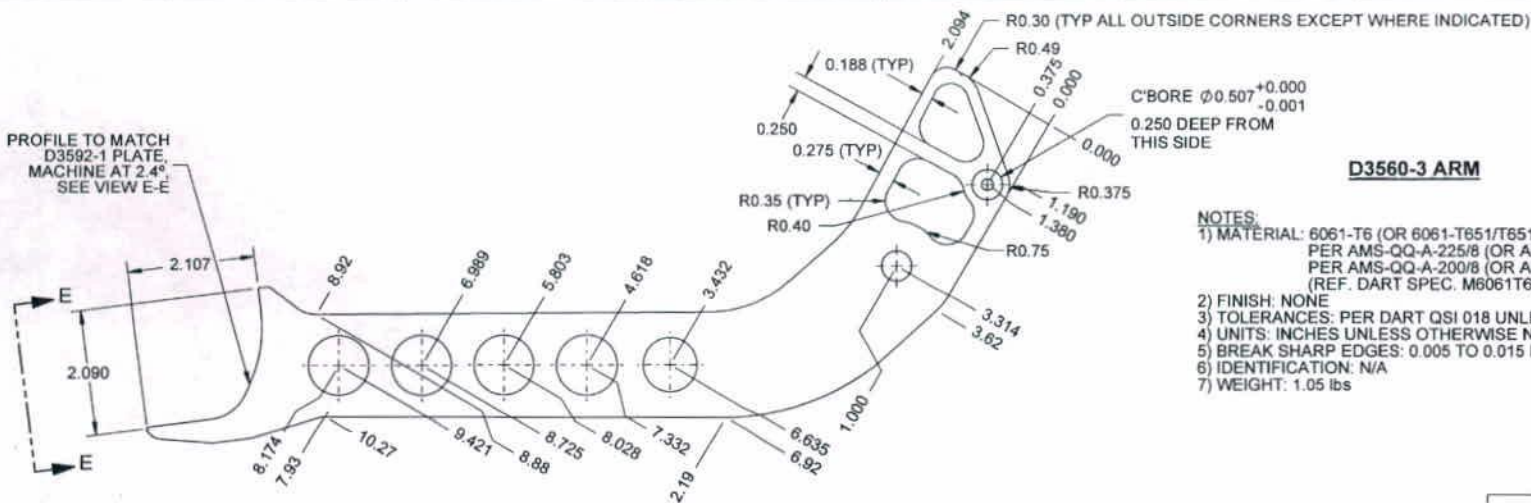


C'BORE $\phi 0.507^{+0.000}_{-0.001}$
0.250 DEEP FROM
THIS SIDE


D3560-3 ARM

NOTES:

- 1) MATERIAL: 6061-T6 (OR 6061-T651/T6510/T6511/T62) BAR, 0.500 THICK
PER AMS-QQ-A-225/8 (OR AMS 4117/4128/4115/4116) OR
PER AMS-QQ-A-200/8 (OR AMS 4160)
(REF. DART SPEC. M6061T6B0.500)
- 2) FINISH: NONE
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.015 MAX
- 6) IDENTIFICATION: N/A
- 7) WEIGHT: 1.05 lbs

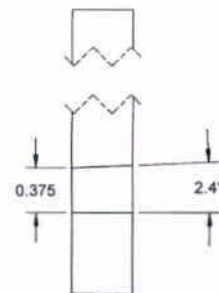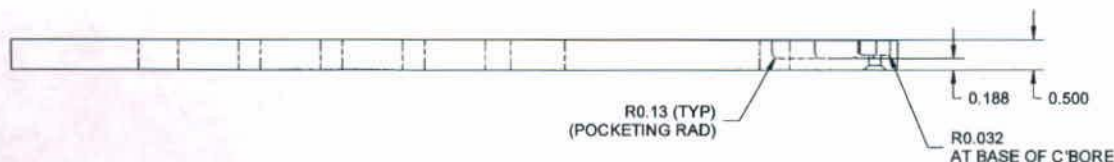

VIEW E-E
SCALE 1:1

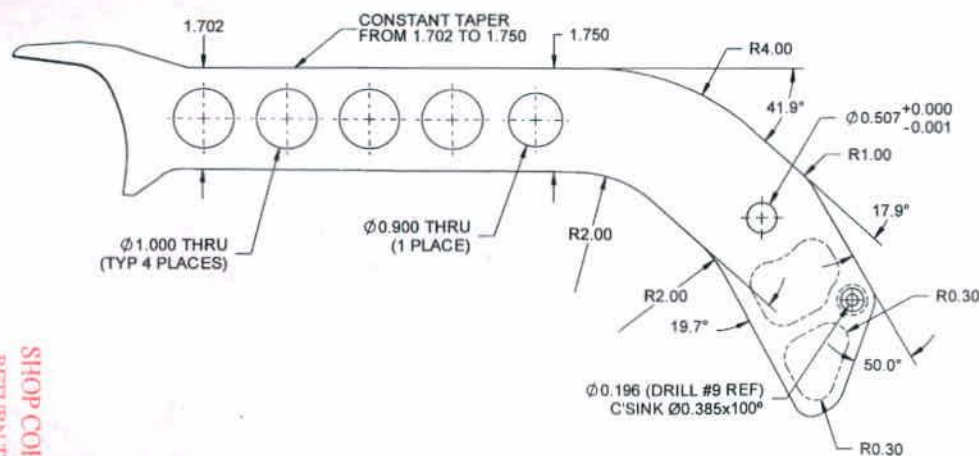

RELEASED
07.12.14

DESIGN	JP	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	JC		
CHECKED	JP	DRAWING NO. D3560	REV. D
MFG. APPR.	JP	SHEET 4 OF 5	
APPROVED	JP	TITLE	SCALE
DE APPR.	JP	ARM WELDMENT	1:2
DATE	07.11.16	COPYRIGHT © 2008 BY DART AEROSPACE LTD <small>THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

NO. 47865
WORK ORDER
WITHOUT NOTICE
ENGINEERING
RETURN TO
SHOP COPY
UNCONTROLLED COPY
SUBJECT TO AMENDMENT

